

Work Order ID 165740

Monday, August 28, 2017 12:57:32 PM

165740

Page 1

Item ID: D2580-1 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: 205 Bent Tube
Start Date: 8/23/2017 Start Qty: 6.00 ***6*** Cust Item ID:
Required Date: 8/28/2017 Req'd Qty: 6.00 ***6*** Customer:
Reference:

Approvals: Process Plan: **DAS 21 9-89** Date: **AUG 29 2017** Tooling: Date: Run Start ***NR1***
QC: Date: SPC (Y/N): Date: Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D2580	H & 17-8-29	0.00							
100		0.00							
100									
Skidtubes	Memo	7.53							
Skidtubes	1- Inspect mat'l D2500-1-190 for damage.								
	2-Drill pilot holes using drill jig DT 8149 A-BC-D								
	3-Open holes to 0.508" as per Dwg D2580								
	4-Deburr holes per QSI002 section 4.2.3 and blow out all chips from inside of tube								
	5- Test fit inspection saddles on FWD & AFT saddle holes using DT9916.								
101	QC6- All purchased or subcontracted products	0.00							
101									
QC	Memo	0.00							
Quality Control									

6 Ø 2617/08/31 AP
TW

DAS
18
9-89

6 x 17-08-31

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

Work Order ID 165740

Monday, August 28, 2017 12:57:32 PM

165740

Page 2

Item ID: D2580-1 Accept *N9000040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: 205 Bent Tube
 Start Date: 8/23/2017 Start Qty: 6.00 *6* Cust Item ID:
 Required Date: 8/28/2017 Req'd Qty: 6.00 *6* Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
110 *110* HandFinish Hand Finishing	Chemical Conversion Coat per QSI005 4.1 Memo	0.00 3.49				(6)	Ø	2017-08-31	JSC BEB
120 *120* QC Quality Control	QC7-Inspect Chemical Conversion Coat Memo	0.00 0.06				6	Ø	17-09-19	BE
125 *125* Skidtubes Skidtubes	 Memo 1- Bond web in place per QSI 015.	0.00 4.98				6	Ø	2017/09/19	AP

A/R Sikaflex-291 batch: 137946
 Sikaflex expire date: 2018/03/29
 Start time and date: 1.00 bond for 12hrs 2017/09/18

② BATCHES →

A/R SIKAFLEX-291 BATCH: 138535
 EX DATE: 2018/04/21
 7.15HR 2017/09/19

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QS1042) Approval	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor Approval Verification
					QC / QA Coordinator Approval
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____	

Work Order ID 165740

Monday, August 28, 2017 12:57:32 PM

165740

Page 3

Item ID: D2580-1 Accept ***N900040100*** Setup Start ***NS1***
Revision ID: Stop ***NS2***
Item Name: 205 Bent Tube
Start Date: 8/23/2017 Start Qty: 6.00 ***6*** Cust Item ID:
Required Date: 8/28/2017 Req'd Qty: 6.00 ***6*** Customer:
Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
130 *130* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.12				6	0	BE 17-09-22	
140 *140* Packaging Packaging	Identify as per dwg & Stock Location: LG002 Memo LOCATION : LG002	0.00 0.06				6		MGB 17/09/22	
150 *150* QC Quality Control	QC21- Final Inspection - Work Order Release Memo	0.00 0.60						17/9/25	

DAS
21
9-89
SEP 22 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS <table style="width:100%; border: none;"> <tr> <td style="width:12.5%;">Skid-tube ☐</td> <td style="width:12.5%;">Cross tube ☐</td> <td style="width:12.5%;">Water Jet ☐</td> <td style="width:12.5%;">Engineering ☐</td> </tr> <tr> <td>Machining ☐</td> <td>Small Fab ☐</td> <td>Prod. Eng. Coord. ☐</td> <td>Quality ☐</td> </tr> <tr> <td>Thermoforming ☐</td> <td>Finishing ☐</td> <td>Rec/Store/Packaging ☐</td> <td>Other ☐</td> </tr> <tr> <td>Large Fab ☐</td> <td>Composite ☐</td> <td>Supplier ☐</td> <td></td> </tr> </table>						Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐	Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐	Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐	Large Fab ☐	Composite ☐	Supplier ☐	
Skid-tube ☐	Cross tube ☐	Water Jet ☐	Engineering ☐																						
Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐																						
Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐																						
Large Fab ☐	Composite ☐	Supplier ☐																							
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																		
Description Work Order Deviation				Disposition				Completed By																	
Root Cause				FAULT CATEGORY																					
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐		No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐															
OTHER : _____																									

Picklist Print

Monday, August 28, 2017 12:57:35 PM

Page 1

Work Order ID: 165740

165740

Parent Item: D2580-1

D2580-1

Parent Item Name: 205 Bent Tube

Start Date: 8/23/2017

Required Date: 8/28/2017

Start Qty: 6.00

Required Qty: 6.00

Comments: IPP B01.11.08 Revised Step 9, 10, 12, and 13 SM IPP Rev:C
10.12.01 as per DEO D1 DD ver:fec

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-190		Manufactured	No			100	Each	90.0000	1	6			
D2500-1-190									**				
Ext'n -1' Beam Tube 4"													

Location	Loc Qty	Loc Code
HALL	18	
151612	18	
LG002	72	
159717	72	

D2596

Manufactured No

100 Each 8.0000 1

6

D2596

Web, 205 Skidtube

**

Location	Loc Qty	Loc Code
LG002	8	
163354	4	
163815	4	

2017/08/29 AP
JW

2017/09/18 AP

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QS1042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :							
Misidentified ☐	Past Due ☐								

ITEM	QTY -041	QTY -045	QTY -047	QTY -049	PART NUMBER	DESCRIPTION
1	X				D2580-041	SKIDTUBE ASSEMBLY
2		X			D2580-045	SKIDTUBE ASSEMBLY
3			X		D2580-047	SKIDTUBE ASSEMBLY
4				X	D2580-049	SKIDTUBE ASSEMBLY
20	1	1	1	1	D2500-1-190	EXTRUSION
21			16	16	D2570	BUSHING
22	1	1	1	1	D2575-3	STEP
23		4			D2579	SPACER
24	16	16	8	8	D2584-1	PLUG
25	16	16	8	8	D2584-3	O-RING
26	1	1	1	1	D2596	205 WEB
27	1	1	1	1	D2855	AFT CAP
28	1	1			D3584-5	WEARSHOE
29	1	1			D3584-9	WEARSHOE
30	1	1			D3584-11	WEARSHOE
31	1	1			D3584-13	WEARSHOE
32	20	20	24	24	D4202-1	SPACER
33			1		D4406-041	WEARPLATE ASSEMBLY
34			1		D4406-043	WEARPLATE ASSEMBLY
35				1	D5081-1	FWD WEARPLATE
36				1	D5081-3	AFT WEARPLATE
50	50	50			ALS7-1032-130 or AKS7-1032-130 or AKS4-1032-130 or AELS-1032-130	INSERT
51	50	50			AN3C4A	BOLT
52	2	2	2	2	AN3-5A	BOLT
53			8	8	AN4-45A	BOLT
54	50	50			NAS1149C0332R	WASHER (AN860C10L)
55	2	2	2	2	NAS1149D0332J	WASHER (AN860JD10L)
56			8	8	MS21042-4	NUT (OR MS21042L4)

GENERAL NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: CHEMICAL CONVERSION PER DART QSI 005 4.1 PRIOR TO INSERTING D2580 WEB
POWDER COAT (-041/-047/-049) GLOSS WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
POWDER COAT (-045) GREEN SANDOMEX (REF 4.3.5.5) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT AS INDICATED PER DART QSI 005 4.4.
- 3) TOLERANCES ARE PER DART QSI 015 UNLESS OTHERWISE NOTED.
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED.
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: D2580-041 = 33.7 lbs
D2580-045 = 33.7 lbs
D2580-047 = 45.1 lbs
D2580-049 = 32.0 lbs
- 8) WELDING PER DART QSI 004.
- 9) INSERT D2580 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH NON-STRUCTURAL SIKAFLEX-241 ADHESIVE PER DART QSI 015 BEFORE BENDING. ENSURE HOLES LINE-UP.
- 10) BEND AS A SMOOTH RADIUS STARTING WITH A MAXIMUM CENTERLINE RADIUS OF 60 AND ENDING WITH A MINIMUM RADIUS OF 30. A MAXIMUM REDUCTION OF 0.200 IN DIAMETER IS ALLOWABLE IN THE BENT PORTION OF THE TUBE.
- 11) USE DART DRILL TEMPLATE DT8217 & DT8937 ONLY FOR D2580-041/-045 TO LOCATE AND DRILL Ø0.297 HOLES FOR WEARSHOE INSERTS. INSTALL ALS7-1032-130 PER SECTIONS B-B AND F-F (50 PLACES) AFTER FINISH. INSTALL AN3C4A BOLTS AND NAS1149C0332R WASHERS WITH SIKAFLEX-241-291.
- 12) INSERT D2584-1 PLUG C/W D2584-3 O-RING IN HOLES MARKED "P" (BOTH SIDES OF TUBE) AFTER FINISH (16 PLACES FOR D2580-041/-045 AND 8 PLACES FOR D2580-047/-049)
- 13) IT IS ACCEPTABLE TO GRIND A RELIEF IN THE D2855 AFT CAP TO PREVENT INTERFERENCE WITH THE SPACER AT THIS LOCATION

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 165740 MJS
120829

RELEASED

2017 JUL 05 4P
ECN17-SLR


H	SHEET: PL DELETE D3586-1/-4/-13 GASKETS, WEIGHTS UPDATED ACCORDINGLY. SHEETS 2 & 4 PICTORIAL UPDATE FOR REMOVAL OF GASKETS	SAD	17.06.09
G	ADDED -045, -047 WEIGHT UPDATED PER DSI 9596	AJS	14.04.09
F	INCORPORATE DEO D2580-E-1 PER PAR12-218	DC	13.06.20
E	ADD D2580-047 (ZN C4-7) AND D2580-7 (ZN B3-8); INCLUDED DEO D2580-D-1; REFORMATTED DRAWING TO CURRENT STANDARDS; DT8217 & DT8937 WAS TD2577-205 (ZN C4-1)	RF	11.06.21
D	CHANGE TO SS WEARPLATES AND GASKETS, INCLUDE DEO 9124/ 9183	PH	07.04.05
C	REDRAWN, INCLUDED DEO 9094/ 9097	CP	06.08.26
B	AS MANUFACTURED	DS	06.12.02
A	NEW ISSUE	DS	06.06.16
REV.	DESCRIPTION	BY	DATE
DESIGN	DS		
DRAWN	SAD		
CHECKED	<i>[Signature]</i>		
MFG. APPR.	<i>[Signature]</i>		
APPROVED	<i>[Signature]</i>		
DE APPR.	<i>[Signature]</i>		
DATE	17.06.09		

DART AEROSPACE LTD
HAWKESBURY, ONTARIO, CANADA


DRAWING NO. D2580
REV. H
SHEET 1 OF 9

TITLE 205 SKIDTUBE ASSEMBLY
SCALE NTS


COPYRIGHT © 1996 BY DART AEROSPACE LTD
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE LTD.

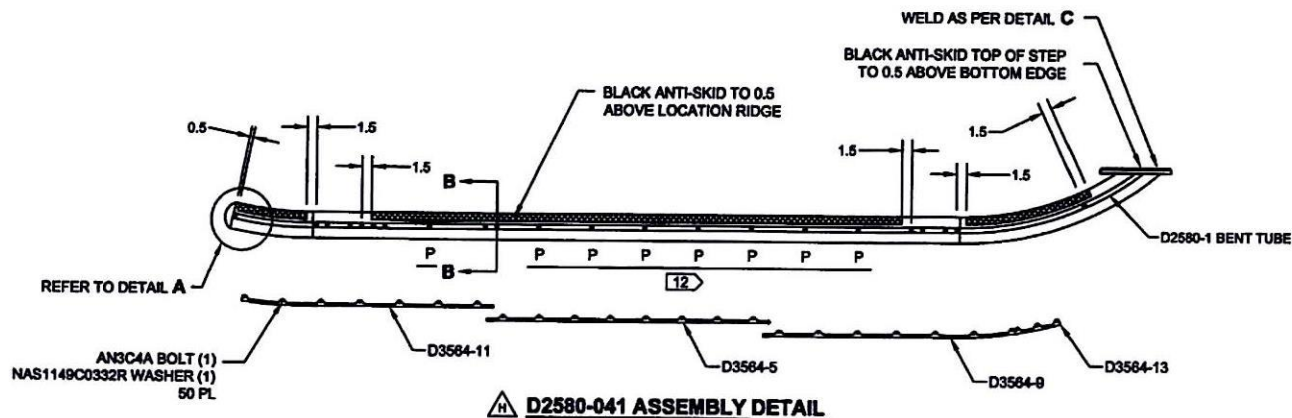

DETAIL A
SCALE 5X

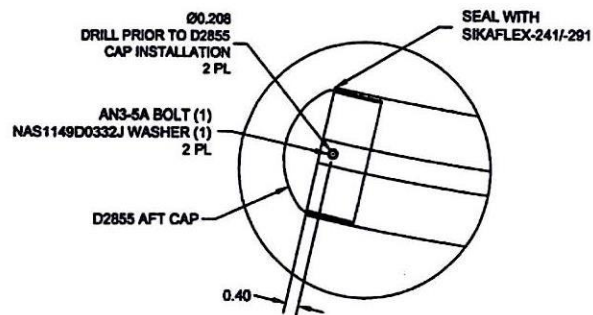


SECTION B-B
SCALE 5X

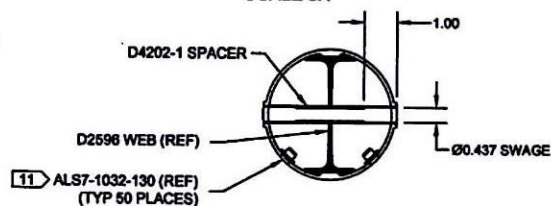

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002


DETAIL C
SCALE 5X

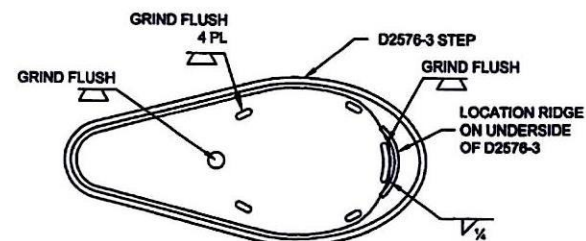

RELEASED

2017 JUL 05


DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO. D2580	REV. H
MFG. APPR.	<i>[Signature]</i>		SHEET 2 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD	

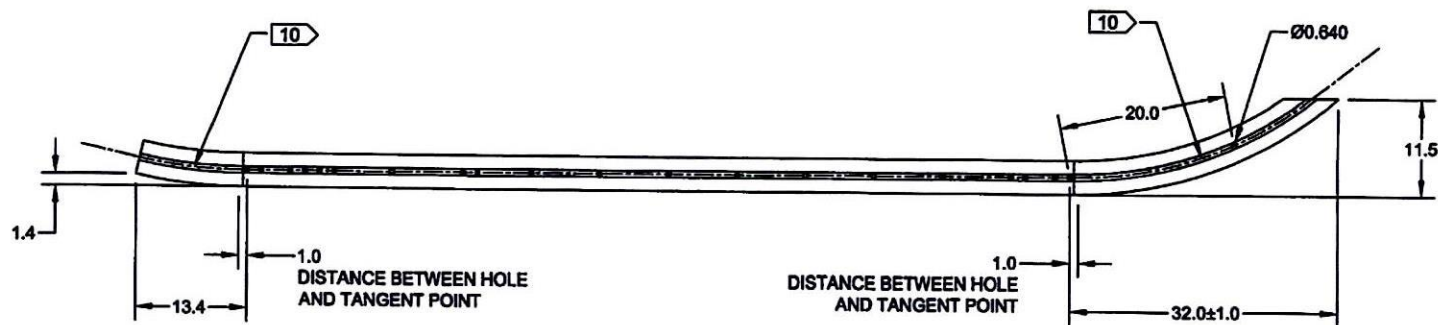

D2580-1 BENT TUBE
(MAKE FROM D2580-101 TUBE)


RELEASED
2017 JUL 05 4P

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO. D2580	REV. H SHEET 3 OF 9
MFG. APPR.	<i>[Signature]</i>	TITLE 205 SKIDTUBE ASSEMBLY	SCALE NTS
DE APPR.	<i>[Signature]</i>	COPYRIGHT © 1999 BY DART AEROSPACE LTD THIS DOCUMENT IS PRELIMINARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	
DATE	17.06.09		

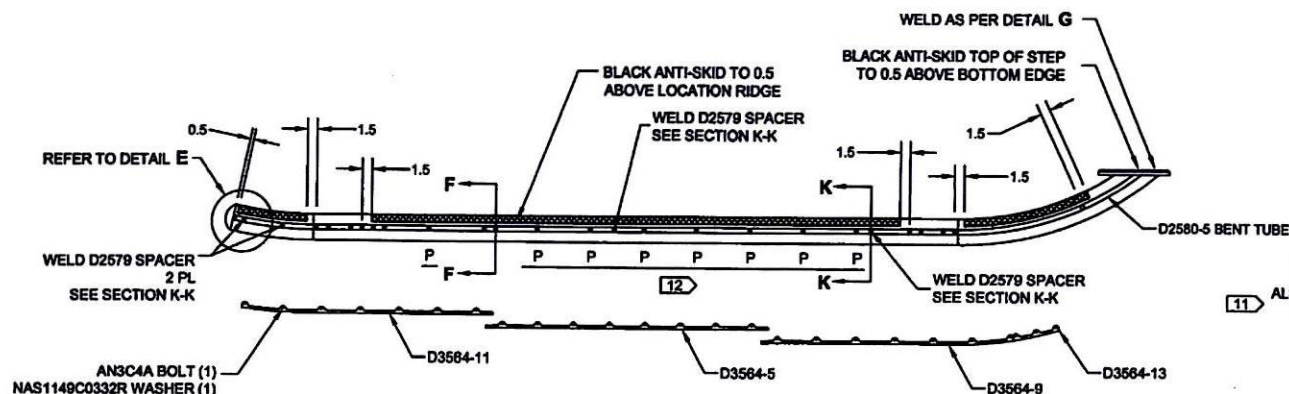


D2580-045 ASSEMBLY DETAIL

**SECTION K-K
SCALE 5X**

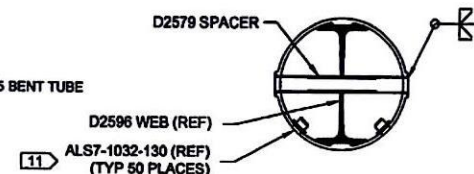


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. CHAMFER HOLE 0.050 X 45°
2. INSERT D2579 SPACER (4 PLACES)
3. WELD INTO PLACE AND GRIND FLUSH
4. DO NOT C'BORE

**DETAIL E
SCALE 5X**

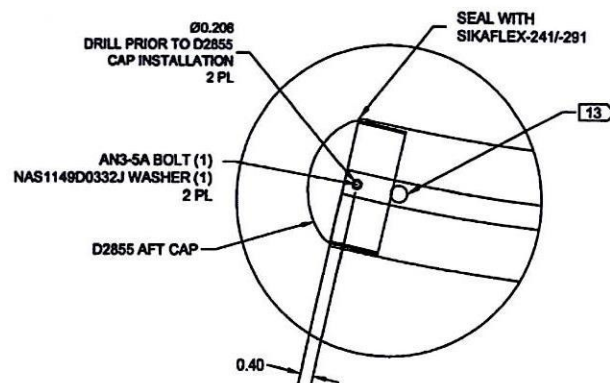


**SECTION F-F
SCALE 5X**

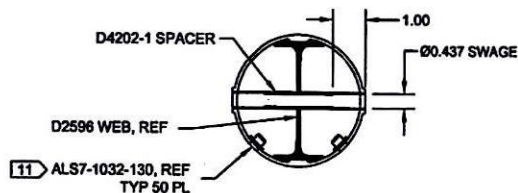


AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:
1. INSERT D4202-1 SPACER (20 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

**DETAIL G
SCALE 5X**

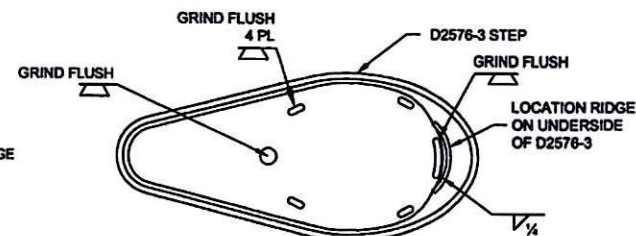

RELEASED
2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 4 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD	
This document is private and confidential, and is supplied on the express condition that it is not to be used for any purpose or copied or communicated to any other person without written permission from DART AEROSPACE LTD.			

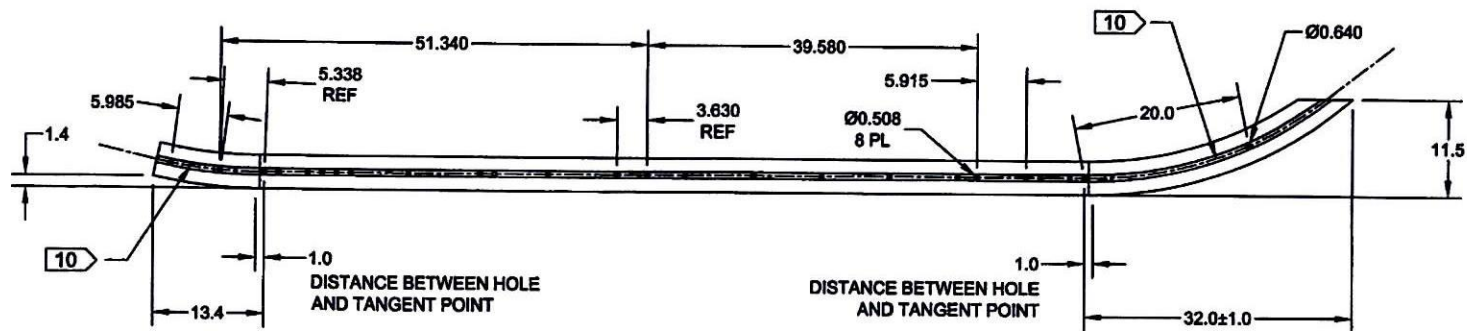


D2580-5 BENT TUBE
(MAKE FROM D2580-101 TUBE)



RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 5 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1986 BY DART AEROSPACE LTD THIS DOCUMENT IS PROPRIETARY AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS UNDERSTANDING THAT IT IS NOT TO BE USED FOR ANY PURPOSES OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

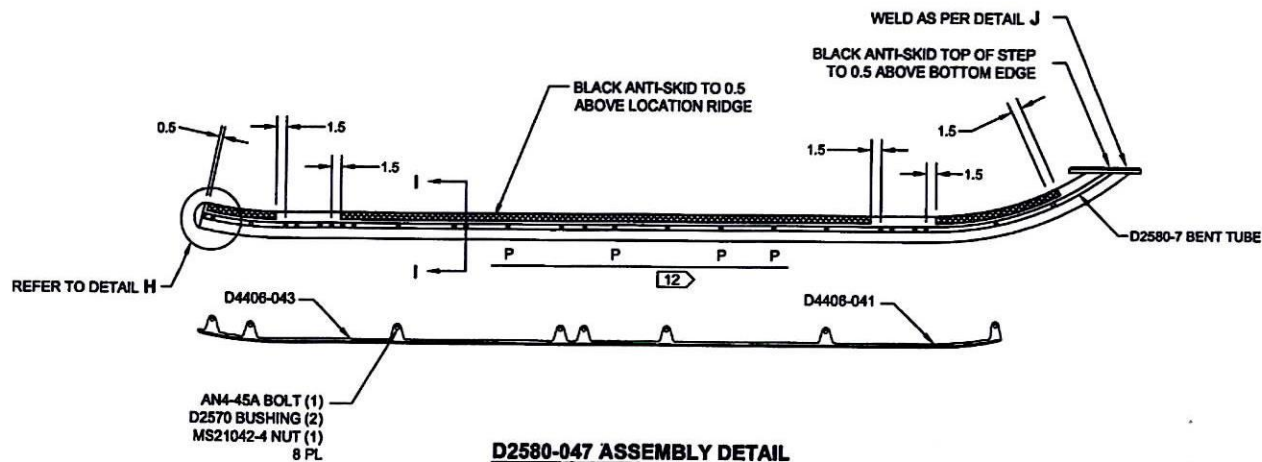


D2580-047 ASSEMBLY DETAIL

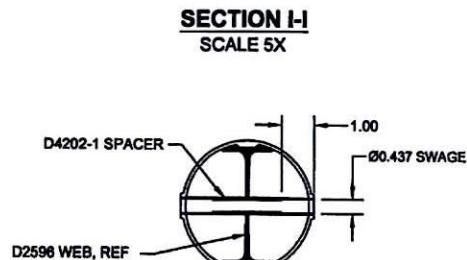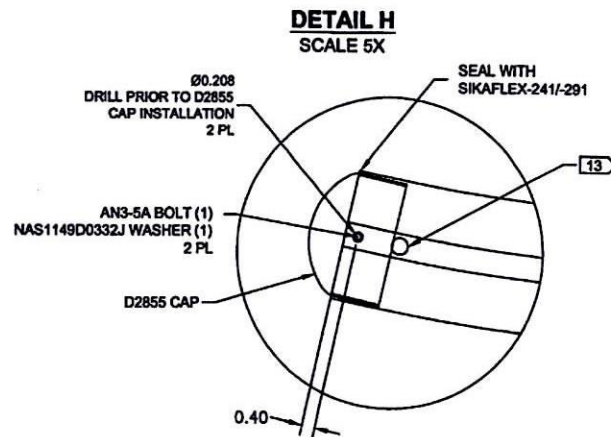

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.508 HOLES ONLY:


1. INSERT D4202-1 SPACER (24 PLACES)
2. SWAGE TO Ø0.437 X 1.00 DEEP PER QSI 002
3. TRIM/GRIND FLUSH PER QSI 002

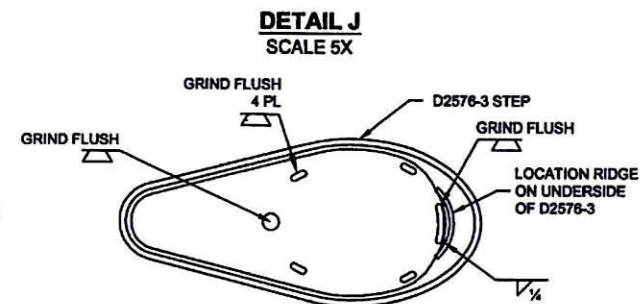

RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED		DRAWING NO.	REV. H
MFG. APPR.		D2580	SHEET 8 OF 9
APPROVED		TITLE	SCALE
DE APPR.		205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY FORM OR BY ANY MEANS WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

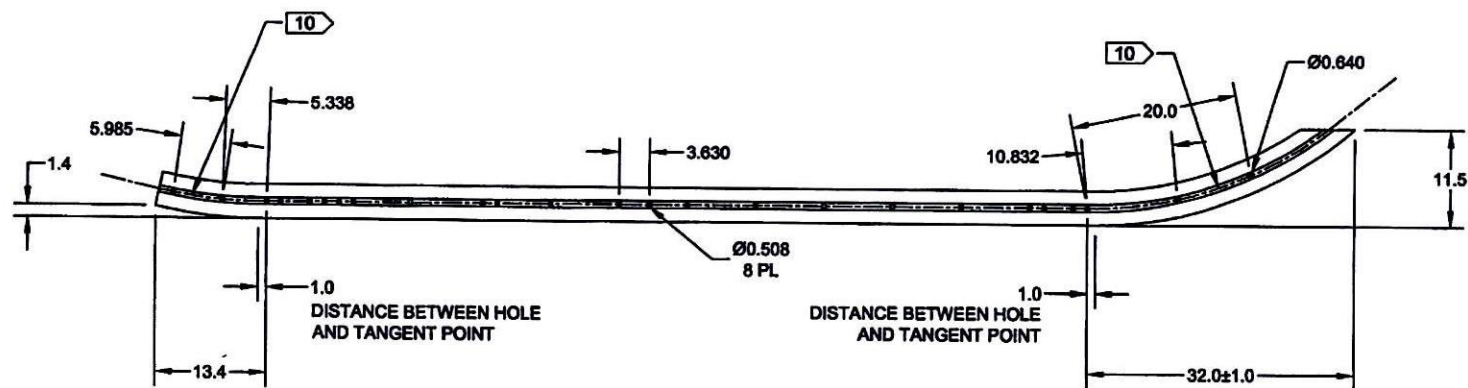


D2580-7 BENT TUBE
(MAKE FROM D2580-101 TUBE)


RELEASED

2017 JUL 05 *JP*

DESIGN	DS	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
DRAWN	SAD		
CHECKED	<i>MKS</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>JS</i>	D2580	SHEET 8 OF 9
APPROVED	<i>JS</i>	TITLE	SCALE
DE APPR.	<i>JS</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1996 BY DART AEROSPACE LTD THIS DOCUMENT IS PROVIDED ON CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

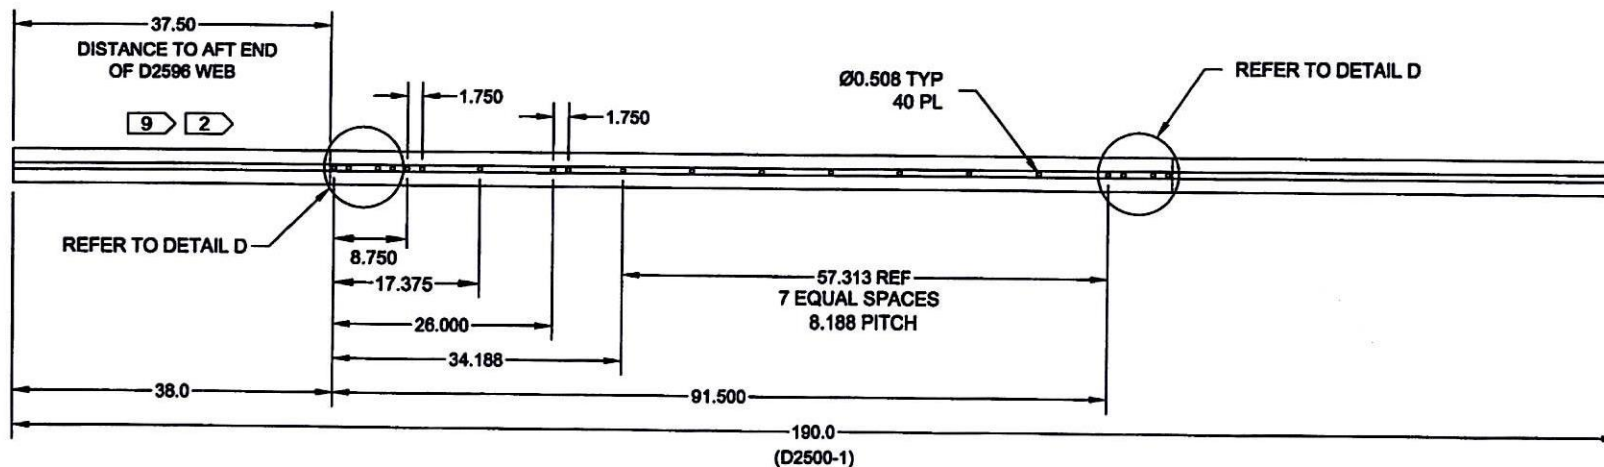

D2580-101 TUBE

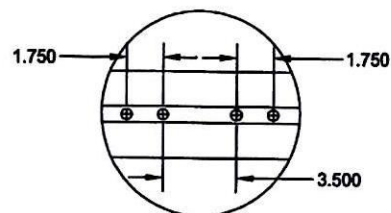

DETAIL D
SCALE 5X

RELEASED

2017 JUL 05

DESIGN	DS	DART AEROSPACE LTD	
DRAWN	SAD	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. H
MFG. APPR.	<i>[Signature]</i>	D2580	SHEET 9 OF 9
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	205 SKIDTUBE ASSEMBLY	NTS
DATE	17.06.09	COPYRIGHT © 1988 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

8 7 6 5 4 3 2 1